

Building Analysis Report

Toll Free: 800.220.5605 Inspector: Richard Thacker, CRI 10-9779 Maryland Home Inspectors License #29896



SAMPLE REPORT

The contents of the sample have been abbreviated for the viewer.

Exterior

The following opinion is based on an inspection of the visible portion of the exterior of the structure. If any conditions are listed, a qualified contractor should correct them.

LANDSCAPING: Landscaping is inspected only to the degree that it affects the condition of the structure. Examples would be

drainage, intruding vegetation, etc.

Site: Level

Location: rear Sloping Location: front

Rating: Appears functional

PAVED AREAS: This category includes steps and/or stoops, sidewalks, walkways, and/or driveways.

Sidewalks: Brick, Pavers Appears functional

Steps: Masonry Steps Location: front

Rating: Appears functional

Driveway: Asphalt

Rating: Appears functional

SIDING/TRIM: Siding refers to the material forming the exterior walls. Masonry construction can perform structural as well

as siding functions.

Siding: Vinyl, Brick

Conditions: Physical damage --- Physical damage was noted and should be repaired.

Location: Minor hole to siding at deck



Rating: Marginal

Trim: Wood, Vinyl, Metal Rating: Appears functional

PORCH/DECK: Porches, decks and patios add value and enjoyment. Because they are exposed to the weather, they are

also higher maintenance items than other portions of the structure.

Porch: Covered Location: front

Rating: Appears functional

Deck: First Level

Location: rear

Conditions: Railing too low --- Safety railing is too low. Have railing raised to a minimum of 36 inches.

Location: Deck



Rating: Safety Concern

WINDOWS: Windows are an important part of the structure, gaining and losing more heat than any other element.

Type: Vinyl, Casement Appears functional

Glazing: Insulated Glass Rating: Appears functional

DOORS: Doors are inspected for functionality and condition. The degree of protection from people or weather is a

matter of personal decision.

Entry: Metal

Rating: Appears functional

GARAGE: Standard inspections cover only attached garages and carports. They are not considered habitable, and

conditions are reported accordingly.

Garage: Attached Garage Rating: Appears functional

Cars: 2

Doors: Metal

Rating: Appears functional

Opener: Automatic

Rating: Appears functional

Roof

This report is made on the basis of what was visible and accessible on the day of inspection. It is not a warranty of the roof system or of how long it may be watertight. If any conditions are listed, a qualified contractor should correct them.

STYLE: The predominant roof style of the structure.

Type: Gable, Hip

COVERING: Covering material is partially a matter of taste, but performs the vital function of keeping water out of the

structure. The life of roofing material can vary greatly depending on geographic area and estimates of

remaining life (if given) are ESTIMATES.

Material: Asphalt Shingle

Missing/cracked shingle --- Roof has missing or cracked shingles that should be replaced. Water Conditions:

penetration could occur.

Location: one missing tab on front right near chimney



Rating: Marginal

SEEN FROM: This section describes the method the inspector used to examine the roof and obviously affect the ability to

observe any conditions.

Walked Method:

OVERHANG: Overhang describes soffits and fascia. This area is important for proper ventilation of the roof and water

removal.

Fascia: Metal

Missing sections --- Sections are missing and should be repaired to help prevent water penetration. Conditions:

Location: Rear fascia end cap above deck



Rating: Marginal

Soffits: Vented Soffit Rating:

FLASHING: Flashing is the material used to seal the junction of the main roof material and items such as chimneys or

vents. It is also used where roof sections join (valleys). This is the most common area for leaks to occur.

Type: Metal

Location: chimney Woven Shingles Location: valley(s)

Rating: Appears functiona

DRAINAGE: This section covers the items used to move the water shed by the roof away from the structure. Water

falling too close to the foundation can cause undermining, settlement and leaks into the structure if present.

Type: Metal

Rating: Appears functional

Down Spouts: Metal

Rating: Appears functional

VENTILATION: The types and condition of attic ventilation is covered in this section. Proper ventilation is important for

maximum life of the roof covering and framing materials.

Type: Ridge, Soffit Appears functional

FLUES/VENTS: Flues are used to vent gases and heat from heating devices and vents are used to vent the plumbing

system to atmosphere. This section describes any damage or problems at the roof level.

Chimney: Brick

Rating: Appears functional

Plumbing: Plastic

Rating: Appears functional

Skylights:

Type: Fixed Unit

Rating: Appears functional

Structure

This inspection is based on observation of the visible portions of the foundation and structure. If any conditions are listed, a qualified contractor should correct them.

FOUNDATION: This is the support for the primary part of the structure. Therefore, it is very important that the proper

material be used and installed. Ventilation is important in order to avoid excessive moisture and resulting

structural damage.

Type: Basement, Crawl Space

Conditions: Minimal ventilation --- Ventilation appears to be minimal. Additional ventilation may be needed to be

installed to help prevent moisture and condensation problems. Correct as needed.

Location: crawl space

Rating: Marginal

Materials: Block

Conditions: Water stains --- Water stains were noted. Stains are evidence of prior water penetrations.



Rating: Monitor

FLOORS: This section covers the floors, primarily in the areas of support and construction. Floor coverings are

discussed in other sections.

Joist: Solid Wood

Rating: Appears functional

Beam: Steel

Rating: Appears functional

Sub Floor: Plywood

Rating: Appears functional

Column: Steel

Rating: Appears functional

Foundation: Masonry

Rating: Appears functional

INSULATION: Floor and wall insulation is examined where visible.

Walls: Not Visible

Floor: Fiberglass

Location: utility room, crawl space

Conditions: Vapor barrier reversed --- Insulation seems to be improperly installed. The vapor barrier should always

face the heated surface. If condensation is noted in the future correction may be necessary.



Rating: Safety Concern

WATER CONTROL: In many areas of the country it may be almost impossible to prevent some water entry into basements or

crawlspaces. Proper water control reduces the amount of water entry and provides for its removal.

Methods: Sump Pump, Sump Pit Rating: Appears functional

WALLS: This section reports on the exterior walls of the building above the foundation and the bulkhead (if any).

Exterior: Frame

Rating: Appears functional

Bulkhead: Steel

Rating: Appears functional

Electrical

The following opinion is based on an inspection of the visible portion of the electrical system. If any conditions are listed, a qualified electrician should correct them.

SERVICE: Exterior service up to and including the meter may be the responsibility of the local power company. If any

problems are noted, contact them for repairs or questions.

Amps: 200

Type: Underground Appears functional

Entrance Mat: Aluminum

Rating: Appears functional

Ground: Driven rod

MAIN PANEL: This is the main power supply panel. Become familiar with its location and study the circuit location

markings if any.

Type: Breaker

Rating: Appears functional

Location: Basement

Amp Rating: 200

Volts: 120/240

BRANCH WIRING: The wiring that makes up the bulk of the electrical system. Because much of it is hidden by walls, insulation,

etc., only the visible portions are examined.

Type: Romex

Rating: Appears functional

Material: Copper

Rating: Appears functional

INTERIOR COMP: The inspection covers a representative number of components. The National Electrical Code has extensive

regulations concerning interior wiring. If you have any doubt about the system, have it thoroughly inspected

by a qualified electrician.

Receptacles:

Conditions: Recept ok --- Using a circuit tester, grounding type receptacles were randomly checked and correct wiring

was indicated.

Rating: Appears functiona

GFI:

Conditions: GFCI ok --- Using a ground fault interrupter (G.F.I.) tester, receptacles checked, indicated a properly

functioning G.F.I. Location: throughout Appears functional

Detector:

Rating:

Conditions: Smoke detector broken --- A smoke detector was broken or inoperable. Replace immediately. These are

life saving devices and are required by building codes.

Location: second floor, second floor

Inadequate amount of smoke detectors. --- Smoke detectors should be located on each floor and in each

bedroom.

Rating: Safety Concern

EXTERIOR COMP: Exterior components add convenience but have additional hazards because of the presence of water.

Receptacles:

Conditions: GFCI ok --- Using a ground fault interrupter (G.F.I.) tester, receptacles checked, indicated a properly

functioning G.F.I. Location: throughout

Rating: Appears functional

Plumbing

The standard inspection report does not include the testing of water salinity, quality or volume of any well supply. Only interior waste systems are inspected. If any conditions are listed, a qualified plumber should repair them.

WASTE/WATER: This section describes the type of water supply and waste system for the structure.

Waste Type: Public

Water Type: Public

MAIN SUPPLY: This section covers the type and material of the main water supply. Learn where your shutoff valve is! If a

supply line ruptures, extensive water damage can occur rapidly.

Material: Not Observed

SUPPLY PIPING: This is the potable water used for drinking and cooking needs.

Piping Mat: CPVC

Rating: Appears functional

Flow: Adequate

WASTE PIPING: This is the waste disposed of from toilets, sinks and other plumbing fixtures.

Piping Material: Plastic

Rating: Appears functional

Flow: Adequate

Rating: Appears functional

HOT WATER: The hot water supply system is inspected where visible. Interior heating elements (if any) are not examined.

Type: Natural Gas

Conditions: No copper stems --- Copper stems copper pipes that are approx. 18" long connecting directly into the water

heater. Copper stems are preferred since they are less susceptible to heat damage from the fueled water

heaters and flues. Copper stems should be installed to prevent undesirable results.



Older Unit --- The item or system is what is considered to be "older", this simply means that is nearing its' maturity and may require replacement in the near future. You may want to monitor the system or appliance and budget for a future replacement.

Rating: Appears functional

Size: 30

Heating

The heating system is one of the most important areas in the structure. Improper maintenance may cause uncomfortable heat and fuel bills can be excessively high. If any conditions are listed, a qualified heat technician should correct them.

SERVICE: All heating equipment should be serviced annually.

Age: 15 to 20 yrs

WARM AIR: Warm air systems heat air and distribute it to the living space via ductwork. These systems include gas and

oil furnaces as well as heat pumps.

Furnace: Forced Air

Conditions: Short cycling --- The furnace appears to be short cycling and in need of service and/or repair. Short cycling

is when the burner shuts down and restarts during a single heating cycle. Have evaluated and serviced by a

specialist.

Rating: Significant / Defective

Duct: Duct Board

Conditions: Insufficient return air --- The inspector feels that there is insufficient return air provided. This will cause

unbalanced heating. Have a heating contractor review the system.

Location: basement

No heat source to each room --- Some areas do not have heat source. Depending on your needs

additional heat may be needed.

Location: basement-rear finished room

Filters: Washable

Conditions: Filter dirty --- Systems air filter is dirty, and should be cleaned or replaced.

Rating: Marginal

FUEL: This section reports the type or types of fuel in use. Most equipment is designed for one type of fuel.

Fuel Type: Natural Gas

Fuel Valve: at furnace

Rating: Appears functional

HEATING FLUES: This section reports on the type and condition of the heating system flues.

Type: Plastic

Rating: Appears functional

FIREPLACE

STOVE: This section reports on masonry and manufactured fireplaces. Flues are rated only to the extent of the type

of flue material used, not the condition of the flues as that can only be inspected by using special equipment

as used by Chimney Sweeps.

Fireplace: Gas

Conditions: No Damper clip --- A damper safety clamp is used to prevent the damper from fully closing. This is

recommended for vented gas burning logs to allow for the venting from an active pilot and flame.

Recommend installing to reduce the risk of carbon monoxide poisoning.

Rating: Safety Concern

Flues:

Conditions: Unable to access --- Unable to fully access the flue or chimney to provide a reasonable assessment.

Kitchen

If any conditions are listed in this section, a qualified contractor should correct them.

EXHAUST FAN: This section describes the type and function of the kitchen exhaust in use.

Type: Above Range Rating: Appears functional

FLOORING: The type of floor covering is noted. Normal wear and tear or cosmetic deficiencies are not noted unless

significant.

Type: Ceramic tile Rating: Appears functiona

CABINETS: The proper amount of cabinets is a matter of personal taste. This inspection is restricted to their overall

condition and installation.

Material: Laminate

Rating: Appears functional

APPLIANCES: Appliances are covered in this section with respects to functionality only.

Range: Gas

Rating: Appears functional

Oven: Gas

Rating: Appears functional

Refrigerator: Double Door Rating: Appears functional

Dishwasher: Built-in

Rating: Appears functional

Microwave: Built-in

Rating: Appears functional

FIXTURES: The type and condition of the kitchen fixtures is reported in this section.

Sink: Double bowl sink Rating: Appears functional

LAUNDRY: Laundry items are inspected if present.

Washer: Electric

Dryer: Electric

Bath

If any conditions are listed, a qualified professional should correct them.

BATH 1/2:

Fixtures: Vanity, Toilet Rating: Appears functional

Ventilation: Fan

Rating: Appears functional

Floor: Sheet vinyl

Rating: Appears functional

BATH 1:

Fixtures: Vanity

Toilet Tub Shower

Location: second floor

Conditions: **Diverter not working ---** Shower diverter was not functional and needs repair.

Rating: Marginal

Ventilation: Fan, Window Appears functional

Floor: Sheet vinyl

Rating: Appears functiona

BATH 2:

Fixtures: Vanity

Shower

Location: master bath

Toilet

Rating: Appears functional

Ventilation: Fan, Window Rating: Appears functional

Floor: Sheet vinyl

Rating: Appears functional

Interior

Cosmetic deficiencies may not be reported on unless they have an impact on habitation or have caused structural damage. If any conditions are listed, a qualified contractor should be consulted.

ACCESS: This section covers restrictions, (if any) to the inspection of the interior. Most common problems are lack of

access because of personal property in the way or recent remodeling which may have covered previous

flaws.

Access: Restricted

Conditions: Attic inaccessible --- The attic was inaccessible to the inspector.

FLOORS: Floor covering types and conditions are reported, if other than cosmetic. For example, loose floor covering

can be a tripping hazard.

Type: Carpet

Location: first floor, second floor

Resilient tile

Location: basement Rating: Appears functional

WALLS: The type, material and integrity of the interior walls are reported on a representative basis only.

Type: Drywall

Rating: Appears functional

CEILINGS: The type, material and integrity of the ceilings are reported on a representative basis only.

Type: Drywall

Location: first floor, second floor

Suspended

Location: basement

Rating: Appears functional

DOORS: The interior doors are reported on a representative basis.

Type: Hollow

Rating: Appears functional

RAILS/STAIRS: Rails and Stairs are inspected in this section. Loose or missing stairs or rails can be hazardous.

Balconies: Wood

Conditions: Spindles too wide --- Spindles are too far apart. Additional spindles should be added to rails to lessen the

spaces between them. This can be hazardous to small children. Recommended to be no more than 4" apart.

Location: balcony railing



Rating: Safety Concern